


March 2012

# CADW SCHEDULED ANCIENT MONUMENTS PCNPA AREA 2011-2



Prepared by Dyfed Archaeological Trust  
For Cadw

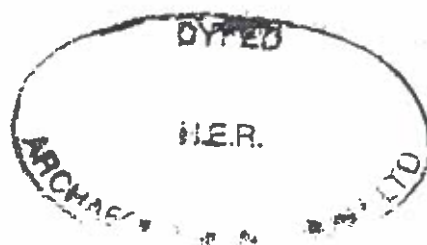

ymddiriedolaeth archaeolegol

**DYFED**  
archaeological trust



**DYFED ARCHAEOLOGICAL TRUST**

**RHIF YR ADRODDIAD / REPORT NO. 2012/30**

**Mawrth 2012**

**March 2012**

**CADW SCHEDULED ANCIENT  
MONUMENTS PCNPA AREA  
2011-2**

**Gan / By**

**Pete Crane**

*Paratowyd yr adroddiad yma at ddefnydd y cwsmer yn unig. Ni dderbynnir cyfrifoldeb gan Ymddiriedolaeth Archaeolegol Dyfed Cyf am ei ddefnyddio gan unrhyw berson na phersonau eraill a fydd yn ei ddarllen neu ddibynnu ar y gwybodaeth y mae'n ei gynnwys*

*The report has been prepared for the specific use of the client. Dyfed Archaeological Trust Limited can accept no responsibility for its use by any other person or persons who may read it or rely on the information it contains.*



Llywodraeth Cynulliad Cymru  
Welsh Assembly Government

Ymddiriedolaeth Archaeolegol Dyfed Cyf  
Neuadd y Sir, Stryd Caerfyrddin, Llandeilo, Sir  
Gaerfyrddin SA19 6AF  
Ffon: Ymholiadau Cyffredinol 01558 823121  
Adran Rheoli Treftadaeth 01558 823131  
Ffacs: 01558 823133  
Ebost: [info@dyfedarchaeology.org.uk](mailto:info@dyfedarchaeology.org.uk)  
Gwefan: [www.archaeolegdyfed.org.uk](http://www.archaeolegdyfed.org.uk)

Dyfed Archaeological Trust Limited  
The Shire Hall, Carmarthen Street, Llandeilo,  
Carmarthenshire SA19 6AF  
Tel: General Enquiries 01558 823121  
Heritage Management Section 01558 823131  
Fax: 01558 823133  
Email: [info@dyfedarchaeology.org.uk](mailto:info@dyfedarchaeology.org.uk)  
Website: [www.dyfedarchaeology.org.uk](http://www.dyfedarchaeology.org.uk)

Cwmni cyfyngedig (1198990) ynghyd ag elusen gofrestredig (504616) yw'r Ymddiriedolaeth. The Trust is both a Limited Company (No. 1198990) and a Registered Charity (No. 504616)

**CADEIRYDD CHAIRMAN: C R MUSSON MBE B Arch FSA MIFA. CYFARWYDDWR DIRECTOR: K MURPHY BA MIFA**



## **SUMMARY**

*This report covers visits and work to Scheduled Ancient Monuments in the Pembrokeshire Coast National Park undertaken by Pete Crane during 2011-2012, for Cadw or for PCNPA. Six sites appeared to have been vandalised, remedial action has been undertaken or instigated on three of these. At least two coastal promontory forts have continuing severe coastal erosion, and another two suffered slightly from fire damage. Two sites are recommended for scheduling and another to have its protected area extended. Vegetation was cleared on two Iron Age promontory forts and on another coastal fort which has been advised for scheduling this has considerably improved their condition.*

## **PRIORITY SITE BASED MANAGEMENT QUERIES FOR CADW SAM sites in numerical order**

**SAM PE 010 Foel Drigarn:** can I repair the hut platform disturbance or will SMC consent be required? Cairns: can the hollows be repaired without further SMC?

**SAM PE 013 St Non's, St David':** Would Cadw part fund geosurvey?

**SAM PE 161 Rock Hewn Cross 220m west of Church, Nevern:** Mortar samples, should these be analysed with view to establishing date of mortar? Will Cadw fund this?

**SAM PE 265 Blackpoint Rath:** Pursue access possibilities with a view to sampling buried soil for dating and environmental evidence and also any other recording possible

**SAM PE 281 Tower Point Rath:** PC to visit site in 2012-13 to observe improvements and investigate the possibility of geophysical survey

**SAM PE 295 Castell Heinif:** Is a full report necessary on the small footpath re-route given that there was minimal disturbance?

### **SAM PE 312 Glyn Gath Round Barrow**

Reported vehicle damage. PC to visit April 2012 and investigate if repairs necessary

**SAM PE 336 Dale Fort:** There should a site meeting with Cadw to look at possible work on the stones around the entrance and further

landscaping of the spoil tip left over from the compound scrape:  
also a possible topographic survey which could also plot the entire  
new fence posts and the spoil tip left over from the contractors'  
compound clearance

**SAM PE 361 Bedd Morris:** Urgent to have stone repaired and  
replaced. Will Cadw fund expenditure on this? PCNPA may be willing  
to provided man power and machinery but not costs

**SAM PE 404 The Old Castle, Newport:** New display panel was  
adjacent to the footpath. Is a separate report, from that below,  
within this document, required on the panel base hole?

## **RECOMMENDATIONS**

Sites to recommended for scheduling

- Solva Ridge Fort
- Trefrane Cliff Colliery

Recommended change to extent of scheduling

- South Hook Fort to include slipway/jetty

Damage due to vandalism and fire appeared to be an increasing  
problem in the last year and it is recommended that a risk  
management plan be prepared for any such future cases.

Further recommendations are made as bullet points in the **site list**  
below.

A meeting should be held in the spring with Cadw to prioritise some  
of the recommendations made.

## **INTRODUCTION**

A number of site visits were made to Scheduled Ancient Monuments  
either directly as part of the Cadw SAM work or as part of other  
work for Pembrokeshire Coast National Park Authority (PCNPA).  
Visits were also made to sites on the Castlemartin Range with MoD  
and PCNPA staff. Furthermore over forty members of The Hill Fort  
Study Group were escorted around a number of sites during their  
tour of Pembrokeshire. This trip was voted as one of their most  
successful excursions.

Small excavations were carried out at the Henry VIII East  
Blockhouse, in advance of coastal erosion, and on the standing  
stone Bedd Morris which was knocked over late in 2011.

Nevern Pilgrims' Cross was slightly vandalised, mortar samples have been undertaken and repairs should now have been done. A few other sites were also deliberately damaged, notably graffiti on one of the stones at Bedd Arthur. All of these cases were reported to the police.

Two Scheduled sites were greatly improved by vegetation clearance in the last year and further manage meant of these by grazing has either been instigated or, subject to land owners agreement, soon to be instigated: At Tower Point Rath the entrance was cleared of vegetation by the; on Dale Point Fort the bramble and thorn were cleared from the defences along with most of the interior (excluding the Victorian Fort and un-scheduled area). The work on both of these forts was undertaken by PCNPA rangers and volunteers. Furthermore substantial scrub was cleared from Solva Ridge fort by National Trust staff and their volunteers, the PCNPA ranger with PCNPA volunteers and a group from a local school (this site is recommended for scheduling). All of these projects were assisted by the archaeologist for PCNPA.

As part of the Cadw work assistance and advice were given to Time Team on their dig at Watery Bay Rath and Gateholm. This was evidently one of their best programs in this season.

#### **SITE LIST: Non-SAM sites at end of list**

##### **SAM PE 010 Foel Drigarn**

The site was visited on 10<sup>th</sup> April 2011 as part of the Hillfort Study Groups' tour of North Pembrokeshire: there was little evidence of any further disturbance to the cairns since the repairs in September 2010. However, the centre of a hut platform just to the north east of the central cairn (NGR by basic GPS SN 15773/33624) had been disturbed (see photo below), possibly the result of metal detecting or geocache activity.





Foel Drigarn hut platform disturbance 10/04/2012, View S



Foel Drigarn damage to hut platform 15/09/2012. View S



The site was visited again on 15/09/2012. The damage to the hut platform was as before. However, on the northwest side to the eastern cairn a slight hollow in the stones has been created. In addition more serious disturbance had been done to the west site of the west cairn (see photos below). The track scars in the turf created by motor bikes the previous year had almost disappeared.

- PG - can I repair the hut platform disturbance or will SMC consent be required?
- Can the hollows be repaired without further SMC?
- PC will visit the site in spring 2012 along with Bedd Arthur
- PC will also visit the site twice on guided walks (7 June and 17 August)



Foel Drigarn slight new disturbance in east cairn, NW side  
15/09/2012



Foel Drigarn: new hollow on west side of west cairn

**SAM PE 013 St Non's, St David's** (Not undertaken as part of Cadw funded SAM management)

This site was noted as a possible geosurvey in 2011. Still of interest but other sites considered more at risk.

- PG - Would Cadw part fund geosurvey?

**SAM PE 035 Kings Quoit Burial Chamber**

No visit was made this year.

- PC to visit next year if in the area, not considered urgent

**SAM PE 052 Carn Ffoi**

The site was visited on 10/02/2012, with Hubert Wilson, DAT surveyor. The extent of the survey and the burnt mounds were discussed. The vegetation on the site is as low as it has ever been recently.

- Survey should take place either very soon or in early 2013, subject to funding

**SAM PE 065 Garn Fawr Camp**

Although the 4 x 4 damage to the site was still noticeable when the Hillfort Study Group visited the site in April 2011, it was almost imperceptible by November 2011. There is a little blackthorn and some bracken on the interior. The blackthorn at this stage is not



considered to be a problem and may have biodiversity advantages. The lower southern side has become increasingly overgrown. More grazing of the site would be an advantage. However, the three ownerships around the site may raise difficulties with boundaries for stock.

- PC to check with National Trust and other landowners to ascertain if the site can be grazed more.
- PC monitor site on yearly basis for the next few years?



Garn Fawr 4 x 4 damage on north side of outer rampart view S.  
09/04/2011



Garn Fawr 4 x 4 damage on north side of outer rampart view S.  
11/11/2011

**SAM PE 161 Rock Hewn Cross 220m west of Church, Nevern**

Seven small areas of damage, where some of the shale rock face adjacent to the cross has been pulled out. The damage may have occurred during the week end of 29-30/10/2011, possibly while removing coins placed between the stones. This was reported to the PCNPA by the people living in the neighbouring property, 'Nevern View'. In most places where the stones have been removed there was evidence that the rear of the stones had been bonded with mortar.

- Mortar samples should be taken before repairs, and analysed with view to establishing date of mortar
- Repairs should be done **as soon as possible**





Nevern Pilgrims Cross: small areas of damage to shale face  
03/11/2011

**SAM PE 194 Watery Bay Rath and SAM 180/181 Gatehome**

The Time Team evaluation on Watery Bay Rath and Gateholm took place in August 2011 with the programme broadcast in January 2012. It appears to have been one of their more successful endeavours and has generally been well received, although some of their conclusions have been commented on. Watery Bay Rath was visited in October with Claudine Gerrard, National Trust Archaeologist for South Wales. All of the backfilled trenches, except for the one on the footpath through the northwest bank (see photo below) were looking good. Here it may be necessary to import some turf and topsoil to improve the sides.

The National Trust archaeologist was unwilling to commit to the scramble onto Gateholm to inspect the backfilled trenches.

A field walking exercise is to be undertaken in the first week of April 2012 on the field immediately to the east of Watery Bay Rath. This is being undertaken jointly with National Trust and PCNPA. The backfilled trenches will be inspected on the Rath at the same time.





Watery Bay Rath, modern entrance through northwest bank as consolidated by Time Team. View S, Scale 0.5. 11/10/2011

- PC to monitor consolidated footpath through northwest bank of Watery Bay Rath
- PC to visit Gateholm with National Trust Ranger to look at backfilled trenches and other erosion issues, especially near the north eastern end of the island

### **SAM PE 195 Great Castle Head, Dale**

The site was visited in May 2011, as mentioned in previous report and again in January 2012. The land slip is much as previously recorded but still on going.

- Recommend monitoring at least every six months.

### **SAM PE 265 Blackpoint Rath**

This site is one of the most seriously eroding and fractured of all of the coastal promontory forts. The site was approached on 16/01/2012, but not entered due to working alone. Unfortunately the light conditions were particularly poor. There appeared to be a buried soil, under what is believed to be the remains of the inner bank (see photo). The eroding south side of the site was also photographed. Subsequent enquires were made to see if a Ranger with climbing experience could assist with access to the site to ascertain if samples from the buried soil could be taken and to inspect some of the fissures for any other archaeological features

- PC to pursue access possibilities with a view to sampling buried soil for dating and environmental evidence and also any other recording possible
- PC to photograph site from footpath in better light (not late in the day or into the sun)
- PC to see if this site could be monitored by Arfordir Volunteer



Blackpoint Rath. Location of possible buried soil. View S.  
16/01/2012



Blackpoint Rath. View N. 16/01/2012

### **SAM PE 273 Porth y Rhaw Camp**

A small fire was reported to PCNPA Oriel Y Parc on 16/05/2011 and this was immediately reported to the Fire Brigade. The site was visited immediately; only a small area c. 2m by 3m had been affected at this stage. The Fire Brigade arrived and were requested to dig as shallow as possible. Unfortunately the fire was well down in the turf and could not be put out. National Trust were to visit next day. National Trust reported still burning and called in Fire Brigade again. Site revisited on 10/06/2011 to record damage. The burn area was located in the second ditch, 10m to NE of cliff edge, extended c. 12.5m along and was maximum of 6m wide. Main disturbance was at the western end and in the south side of the ditch into the second bank. Where dug c.0.3m down by Fire Brigade only in top of ditch fill and no sign of any bank structure. The remaining turf was replaced to encourage re-growth.





Porth y Rhaw: maximum burn area before turf replaced 10/06/2011

- Recommend PC to inspect and record re-growth along with eroding inner bank edge

### **SAM PE 281 Tower Point Rath**

The entrance to this site had become overgrown and subsequently a footpath was being created over the bank causing minor erosion. The site was visited on 19/05/2011. Two separate days (12/10/2011 and 29/02/2011) were spent with the Ranger Haydn Garlic and 4 PCNPA volunteers to clear the entrance. Furthermore arrangements are being made by PCNPA to start grazing the site, particularly as the grass on the interior is becoming long with tussocks forming. This improvement would enable geophysical survey to be more readily carried out. More clearance of scrub on the bank and in the ditches is envisaged.

- PC to visit site in 2012-13 to observe improvements and investigate the possibility of geophysical survey



Tower Point Fort entrance before clearance. View W. 19/05/2011



Tower Point Fort after clearing. View NW. 29/02/2012



**SAM PE 295 Castell Heinif** (Not down as Cadw SAM time)

Following the site meeting the coastal path was re-routed along the inner ditch in January 2012. The hedge bank at the southern end of the defences was cut to allow the new path into the inner ditch. At the northern end there was the base of a former hedge bank which was very slightly reduced to remove a trip hazard. Postholes were dug in non-sensitive areas for direction signs at either end of the diversion. The old path has been left as it was. It is not considered that there was any disturbance to the Iron Age elements of this site.

- PC: To visit twice in 2012 to monitor new route and erosion
- PG - is a full report necessary?



Castell Heinif: cut through hedge banks at south end. View S.  
18/01/2012



Castell Heinif: edge of hedge bank at north end of inner ditch.  
Removed as potential trip hazard. View S. 18/01/2012

### **SAM PE 302 Sister's House**

A site visit was finally made on 02/12/2011 after two attempts aborted due to extremely high winds. There was evidence that the two leaning trees on the "Chapel" vault are causing damage to the structure. A very large tree had recently come down adjacent to the south side of the house and a significant limb from a tree to the east. This is likely to exacerbate the movement of the trees on the ruins of the house.





Sisters House, "Chapel" trees causing damage to vault. View NE.  
02/12/2011



Sisters House, house ruins with large tree on vault. View E.  
02/12/12

Due to continuing issues with the trees on the site and the apparent perception that little could be done, a site meeting was arranged on 20/01/2012. The conclusion was that the site should be cleared of some trees and scrub; the ruins are the most important aspect; vaults will not survive if clearance not done; this would be best for bats; owners consent necessary before any action; subject to consent, management plan to be prepared.

- PC to contact landowner concerning possible clearance and guided walks on site
- Subject to landowner meeting with PCNPA, Conservation to clear trees and vegetation





Sisters House, House ruins. View NW. 02/12/2011

**SAM PE 312 Glyn Gath Round Barrow**

Reported in January 2012 by PCNPA ranger as having been damaged by a vehicle or vehicles driving over it. Site visit was arranged combined with other work but ran out of time, and a second visit was abandoned due to conditions being very mist,

- PC to visit April 2012 and investigate if repairs necessary

**SAM PE 321 St Govan's Chapel and Well**

Two stones had been dislodged to the right of the altar in the chapel: this was reported by the PCNPA Ranger for Castlemartin. The site was visited on 15/12/2011. The damage was probably deliberate, but could just have been carelessness.

- Replace or repair to right side of altar. Not considered urgent

**SAM PE 320 Buckspool Down Camp**

This site was visited on 15/12/2012 with Anna Sutcliffe of Landmark Trust for the MoD with a view to putting up a new fence. The new fence is on the cliff edge and below the monument.

**SAM PE 323 Deer Park Promontory Fort**

The site was visited on 5/10/2011 after a fire (seen from Solva!). An area of thorn just inside the rampart to the north of the entrance had nearly all burnt. A possible wall line was noted (4 stones in a line), and also a flint flake and a pebble, possibly a small hammer



stone. Some modern rubbish was revealed by the fire and this was pointed out to the National Trust Archaeologist when visiting a week later, who was going to arrange to have this cleared.



Deer Park. Part of burnt area. View NNW. Scale 2m. 05/10/2011



Deer Park: Possible wall in burnt area. View NW. Scale 1m. 05/10/2011

The consolidation undertaken by the National Trust at the southern end of the rampart, has not been successful, probably due to subsequent weather conditions and needs to be done again. Possibly the best time would be early spring when re-growth is likely to be more vigorous.



Deer Park: unsuccessful re-turfing of southern end of rampart. View NW. Scales 1m. 05/10/2011

- National Trust to re-do and possibly extend consolidation at south end of site

### **SAM PE 336 Dale Fort**

Several visits were made to this site this year as there were some problems with lack of completion of vegetation clearance, especially on the bank and ditch south of the Iron Age entrance. The last visit was on 20/01/2012 when this had still not been done. However, the ranger has now undertaken the last of this clearing.

The chicken hut and old compound fencing on the adjacent non-scheduled part of the site was removed by May 2011, but the area is still a bit untidy (see photo below).





Dale Fort area adjacent to north side of SAM. View WNW  
06/05/2011

The higher part of the interior within the newly fenced area has mostly been cleared of blackthorn and the horses now grazing the site appeared to be keeping the bracken down (see photos below).



Dale Fort: Interior from bank, south of entrance, "compound clearance spoil tip in foreground" vegetation much reduced by cutting and grazing. View NE 20/01/2012



Dale Fort: Clearance on north side of interior View E 20/01/2012

- PC and PG: A site meeting should be considered to look at possible work on the stones around the entrance and further landscaping of the spoil tip left over from the compound scrape. Possible topographic survey in the near future which could also plot the entire new fence posts and the spoil tip left over from the contractors' compound clearance.

### **SAM PE 361 Bedd Morris**

In early October, probably during the weekend of 8-9 October the standing stone was broken off just below ground level. An interview was done for HTV Wales later that week. There were some delays in undertaking the work on the site, partly due to gaining permissions from landowners and other regulatory bodies.

A small excavation was undertaken in early February which indicated that the bottom of the stone was *in situ* complete with hammer stones in the filled-in pit. Adjacent to the stone was a pebbled floor. The stone would therefore appear to be Bronze Age and the major damage was probably done a few years ago when the stone was hit by a lorry. Both parts of the stone are now on a nearby farm.

- A report for this excavation is in process
- Kieran Elliot is preparing costs for repair to the stone



- The PCNPA preference is to have the stone replaced in the same location as soon as possible
- PC to take Kieran Elliot to inspect stone to finalise costs
- Soil samples to be analysed
- Charcoal sample to be radiocarbon dated



Bedd Morris, broken upper stone. Scale 1m. 10/10/2011



Bedd Morris, base of stone, hammer stone and concrete repair. View E. Scale 0.5m 08/02/2012



### **SAM PE 398 East Blockhouse (Henry VIII's)**

Parts of the remains of Henry VIII's East Blockhouse at West Angle were investigated in July 2011. Staff from Dyfed Archaeological Trust and a total of ten volunteers took part. Most of the volunteers were local and associated with the Arfordir Project.

The remains of this site are on a cliff edge which suffered a large land slip in the winter of 2010-11; when a further slip occurs it will probably render this site unsafe for further excavation, hence the necessity for this rescue dig. The work confirms the historical records that the building was never finished and furthermore that it was substantially cleared out during World War II, when it became a defended lookout. The scant remains of another building, recorded in the 1990s as already lost, were identified, but as they were right on the cliff edge it was considered too dangerous to investigate further. One WW2 gun pit was excavated together with a platform just inland that turned out to be natural. A geocache is in use within a probable putlog hole, and was the reason for three visiting groups to the site: its location is not envisaged as a problem; a short report is in progress and will be accessible via the DAT web site.

- It is recommended that this site is monitored at least once a year, preferably in the spring as landslips are more likely over the winter. Of particular importance are the scant remains of the second building, more of which may be revealed as the cliff edge erodes.



East Blockhouse Angle during excavation. WWII gun pit in front of the building being investigated.

### **SAM PE 404 The Old Castle, Newport**

On 15/04/2011 a display panel was placed c. 11.25 to c.12.00m east of the end of the tennis court and 0.4 to 1m south of the edge of the path. The base was dug to 0.6m below the surface all into a twentieth century rubbish dump.

There was undergrowth over the east side of the ring work. There did not appear to be any recent badger activity, but there was some Japanese Knotweed to the north of the scrub on the bank

- PG: - Is a separate report required on the panel base hole?
- PC monitor scrub and burrows annually



Old Castle, Newport, scrub on east side of ringwork. View NW  
15/04/2011

### **SAM PE 410 Solva Promontory Fort Gribin**

The National Trust have continued to clear the site and treat the stumps. The appearance of the site continues to improve. PCNPA hope to cut the brush on the interior of the fort and the site will be surveyed if Louise Barker from RCAHMW has time after undertaking the ridge fort work. PCNPA may also undertake a geophysical survey of the interior. The vegetation in the rock cut ditch could be cleared as could some blackthorn towards the south eastern end.

- PC and RCAHMW Detailed topographic survey
- PC geophysical survey of interior?

**SAM PE 429 Cottage, Mill and Lime Kiln at Caerbwdy**

PC met with CCW officer to enquire about the Tir Gofal agreement with the landowner of Caerbwdy Mill. A site visit was made on 19/09/2011; no clearance of the site had been undertaken. Much of the machinery is still within the building. At short notice a Ranger and volunteers became available to start clearing on the site. However, the Ranger met the "owner" and evidently there is some dispute about ownership of the site and also the intentions of the current occupier may not be in keeping with PCNPA planning. Therefore after a brief discussion between the Ranger and PC it was decided that PCNPA should not be involved at this stage with any work on the site.

- PC to visit the site late in 2012 to see if any work has been done to the site as part of the Tir Gofal agreement.



Caerbwdy Mill, overgrown. View W. 19/09/2011





Caerbwdy Mill, remains of walls and machinery. View N. 19/09/2011

### **SAM PE 436 Limekilns at Kiln Park**

Site meeting took place on 15/05/2011 arranged by Louise Mees. The impression was positive but will have to wait see if anything takes place.

- PC: To look at history of limekilns in general within the Pembrokeshire Coast National Park, with a view to help with any information required regarding history of the site and putting it in context
- PC: To establish if building recording prior to consolidation is within his remit
- PC: To establish if PCNP staff and / or volunteers are available to assist with vegetation clearance

### **SAM PE 464 Bedd Arthur**

After visit on 15/09/2011: Reported graffiti on the stone re-erected previously, to Cadw, local Police and Chief Inspector Mark Harrison (English Heritage Policing Advisor, who was most helpful). Local PCNPA Ranger Richard Vaughan made a number of inquiries to trace possible suspects but no results to date. After consultation it was decided at this stage not to treat the graffiti in any way, but let nature take its course. However, it is considered that if this graffiti remains obvious it may well encourage further vandalism to the

site. Sheep scrapes are re-appearing on the same locations as before.

- PC to visit early in spring 2012 and after the summer 2012



Bedd Arthur Graffiti on stone 15/09/2011

### **SAM PE 483 First World War Practice Trenches, Penally Range Trenches**

A site visit was made with Anna Sutcliffe of Landmark Trust for the MoD to look at grazing issues, notably sheep scrapes, plus some rabbit activity on 14/04/2011. The scrapes are not too bad at the moment and no action or infilling is necessary at the moment.

- Recommend detailed plot and photo of scrapes and holes then monitor at yearly intervals
- Possibly very small notices about WWI trenches could be placed on nearby Coastal Footpath gates





Penally WWI trenches, sheep scrape 14/04/2011



Penally WWI trenches, sheep scrape 14/04/2011

### **Frainslake Sands**

Peat exposure has been monitored by both the PCNPA Rangers and Archaeologist during visits and tours. This year sand has mostly covered the peat deposits.

- PC Monitor annually

### **Trefrane Cliff Colliery PRN 7266**

It is believed that the sale of this site has just gone through. The new owner is thought to be Bruce Sanderson of Newgale Surf Shop. PCNPA ranger Phil Lees has informed me that he would like a meeting to discuss consolidation and other issues (sounds positive).

- PC to investigate the intentions of the new owners with a view to establishing a working relationship regarding this site.

### **Solva Ridge Fort**


The National Trust with a little assistance from PCNPA Ranger and Portfield School pupils and PC have nearly cleared the site. The number of hut platforms visible has increased from about 8 to 15. After consideration it was decided that this site was more suitable for a professional EDM/GPS survey rather than using Arfordir volunteers due to the site's complexity and steep nature of the site: Louise Barker from RCAHMW and PC are due to undertake a topographic survey of the site at the end of April 2012.

- Recommend scheduling site when the site plan has been produced



Solva Ridge Fort: vegetation being cleared with National Trust and PCNPA plus Portfield School pupils. One of the hut platforms in foreground. 26/01/2012





# CADW SCHEDULED ANCIENT MONUMENTS PCNPA AREA 2011-2

**RHIF YR ADRODDIAD / REPORT NUMBER 2012/30**

Mawrth 2012  
March 2012

Paratowyd yr adroddiad hwn gan / This report has been prepared by Pete Crane

Swydd / Position: Archaeologist

Llofnod / Signature .....  ..... Dyddiad / Date 11/4/2012

Mae'r adroddiad hwn wedi ei gael yn gywir a derbyn sêl bendith  
This report has been checked and approved by Louise Austin

ar ran Ymddiriedolaeth Archaeolegol Dyfed Cyf.  
on behalf of Dyfed Archaeological Trust Ltd.

Swydd / Position: Head of Heritage Management

Llofnod / Signature  ..... Dyddiad / Date 16/4/2012

Yn unol â'n nôd i roddi gwasanaeth o ansawdd uchel, croesawn unrhyw sylwadau sydd  
gennych ar gynnwys neu strwythur yr adroddiad hwn



